

SECTION 1: Identification of the substance/mixture and of the company/undertaking

1.1. Product identifier

Trade name : Wilsonart 740/741 Adhesive
Product form : Mixture

1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Canisterized contact adhesive

1.3. Details of the supplier of the safety data sheet

Wilsonart LLC
P.O. Box 6110
Temple, TX 76503-6110
Information phone: 800-433-3222 (USA)
In Case of Emergency Contact CHEMTREC (International): 703-527-3887

1.4. Emergency telephone number

Emergency number : CHEMTREC: (800) 424-9300

SECTION 2: Hazards identification

2.1. Classification of the substance or mixture

GHS-US classification

Flam. Gas 1 H220
Skin Irrit. 2 H315
Eye Irrit. 2A H319
Skin Sens. 1B H317
Repr. 2 H361
STOT SE 3 H336
STOT RE 2 H373

2.2. Label elements

GHS-US labelling

Hazard pictograms (GHS-US) :



Signal word (GHS-US) :

Danger

Hazard statements (GHS-US) :

H220 - Extremely flammable gas
H315 - Causes skin irritation
H317 - May cause an allergic skin reaction
H319 - Causes serious eye irritation
H336 - May cause drowsiness or dizziness
H361 - Suspected of damaging fertility. Suspected of damaging the unborn child
H373 - May cause damage to organs through prolonged or repeated exposure

Precautionary statements (GHS-US) :

P201 - Obtain special instructions before use
P202 - Do not handle until all safety precautions have been read and understood
P210 - Keep away from heat, hot surfaces, open flames, sparks. - No smoking
P260 - Do not breathe gas, mist, spray, vapours
P261 - Avoid breathing gas, mist, spray, vapours
P264 - Wash hands, forearms and face thoroughly after handling
P271 - Use only outdoors or in a well-ventilated area
P272 - Contaminated work clothing must not be allowed out of the workplace
P280 - Wear eye protection, protective clothing, protective gloves
P302+P352 - If on skin: Wash with plenty of soap and water
P304+P340 - IF INHALED: Remove person to fresh air and keep comfortable for breathing
P305+P351+P338 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing
P308+P313 - If exposed or concerned: Get medical advice/attention
P312 - Call a doctor, a poison center if you feel unwell
P314 - Get medical advice/attention if you feel unwell
P321 - Specific treatment (see first aid instructions on this label)
P332+P313 - If skin irritation occurs: Get medical advice/attention
P333+P313 - If skin irritation or rash occurs: Get medical advice/attention
P337+P313 - If eye irritation persists: Get medical advice/attention
P362 - Take off contaminated clothing and wash before reuse
P362+P364 - Take off contaminated clothing and wash it before reuse

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

P377 - Leaking gas fire: Do not extinguish, unless leak can be stopped safely
P381 - Eliminate all ignition sources if safe to do so
P403 - Store in a well-ventilated place
P403+P233 - Store in a well-ventilated place. Keep container tightly closed
P405 - Store locked up
P501 - Dispose of contents/container to hazardous or special waste collection point, in accordance with local, regional, national and/or international regulation

2.3. Other hazards

Other hazards not contributing to the classification

: When this material is used as intended, it will not present an aspiration hazard. However, there are components within the material that would create an aspiration hazard in liquid form.

2.4. Unknown acute toxicity (GHS-US)

No data available

SECTION 3: Composition/information on ingredients

3.1. Substance

Not applicable

3.2. Mixture

Name	Product identifier	%
Acetone	(CAS No) 67-64-1	10 - 30
Isobutane	(CAS No) 75-28-5	10 - 30
Propane	(CAS No) 74-98-6	7 - 13
Dimethyl ether	(CAS No) 115-10-6	7 - 13
Pentane	(CAS No) 109-66-0	7 - 13
Distillates, petroleum, light distillate hydrotreating process, low-boiling	(CAS No) 68410-97-9	3 - 7
Toluene	(CAS No) 108-88-3	3 - 7
Cyclohexane	(CAS No) 110-82-7	1 - 5
Hexane	(CAS No) 110-54-3	0.1 - 1

SECTION 4: First aid measures

4.1. Description of first aid measures

First-aid measures general

: If exposed or concerned, get medical attention/advice. Show this safety data sheet to the doctor in attendance. Wash contaminated clothing before re-use. Never give anything to an unconscious person.

First-aid measures after inhalation

: IF INHALED: Remove to fresh air and keep at rest in a position comfortable for breathing. Get medical attention if breathing is affected. If breathing is difficult, supply oxygen.

First-aid measures after skin contact

: IF ON SKIN (or clothing): Remove affected clothing and wash all exposed skin with water for at least 15 minutes. If irritation develops or persists, get medical attention.

First-aid measures after eye contact

: IF IN EYES: Immediately flush with plenty of water for at least 15 minutes. Remove contact lenses if present and easy to do so. If pain, blinking, or irritation develops or persists, get medical attention. Continue rinsing.

First-aid measures after ingestion

: IF SWALLOWED: rinse mouth thoroughly. Do not induce vomiting without advice from poison control center or medical professional. Get medical attention if you feel unwell.

4.2. Most important symptoms and effects, both acute and delayed

Symptoms/injuries

: May cause drowsiness or dizziness. Causes serious eye irritation. Suspected of damaging fertility. Suspected of damaging the unborn child. May cause an allergic skin reaction. Causes skin irritation. Causes damage to organs through prolonged or repeated exposure.

Symptoms/injuries after inhalation

: May cause drowsiness or dizziness.

Symptoms/injuries after skin contact

: May cause an allergic skin reaction. Causes skin irritation.

Symptoms/injuries after eye contact

: Causes serious eye irritation.

Symptoms/injuries after ingestion

: May cause gastrointestinal irritation.

Chronic symptoms

: Suspected of damaging fertility. Suspected of damaging the unborn child. Causes damage to organs through prolonged or repeated exposure.

4.3. Indication of any immediate medical attention and special treatment needed

No additional information available

SECTION 5: Firefighting measures

5.1. Extinguishing media

Suitable extinguishing media

: Foam. Dry powder. Carbon dioxide, Water Fog.

Unsuitable extinguishing media

: Direct Water Spray.

5.2. Special hazards arising from the substance or mixture

Fire hazard

: Extremely flammable gas. Vapor may cause flash fire.

Explosion hazard

: Static discharge may serve as an ignition source for this product.

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

5.3. Advice for firefighters

- Firefighting instructions : Exercise caution when fighting any chemical fire. Do not dispose of fire-fighting water in the environment. Prevent human exposure to fire, fumes, smoke and products of combustion. Use cold water spray to cool fire-exposed containers to minimize risk of rupture.
- Protection during firefighting : Do not enter fire area without proper protective equipment, including respiratory protection.

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

- General measures : Evacuate area. Keep upwind. Ventilate area. Spill should be handled by trained clean-up crews properly equipped with respiratory equipment and full chemical protective gear (see Section 8). Avoid vapor formation. In case of spills, beware of slippery floors and surfaces. Eliminate all sources of ignition. Vapor may cause flash fires. Vapors are heavier than air and can travel long distances to ignition sources.

6.1.1. For non-emergency personnel

- Protective equipment : Wear Protective equipment as described in Section 8.
- Emergency procedures : Evacuate unnecessary personnel.

6.1.2. For emergency responders

- Protective equipment : Wear suitable protective clothing, gloves and eye or face protection. Approved supplied-air respirator, in case of emergency.

6.2. Environmental precautions

- Prevent entry to sewers and public waters. Avoid release to the environment.

6.3. Methods and material for containment and cleaning up

- For containment : Contain any spills with dikes or absorbents to prevent migration and entry into sewers or streams.
- Methods for cleaning up : Remove all sources of ignition. Avoid breathing of vapors. Wear appropriate respirator and other protective clothing. Ventilate. Shut off source of leak only if safe to do so. Soak up with absorbent material, and place in non-leaking containers for proper disposal.

6.4. Reference to other sections

- No additional information available

SECTION 7: Handling and storage

7.1. Precautions for safe handling

- Precautions for safe handling : Keep away from heat, sparks and open flames. Use adequate ventilation and avoid repeated or prolonged skin contact. Wash hands and other exposed areas with mild soap and water before eating, drinking or smoking and when leaving work. Provide good ventilation in process area to prevent formation of vapour. Ground/bond container and receiving equipment. Prohibit smoking in storage area.

7.2. Conditions for safe storage, including any incompatibilities

- Storage conditions : Store in a well-ventilated place. Keep container tightly closed. Isolate from oxidizers, heat, sparks, electrical equipment and open flame. Closed containers may explode if exposed to extreme heat. Store in a cool dry place. Prohibit smoking in storage area. Do not store with acids or oxidizers. Electrical service in storage area must be rated for flammable liquids.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Distillates, petroleum, light distillate hydrotreating process, low-boiling (68410-97-9)	
Remark (ACGIH)	OELs not established
Remark (OSHA)	OELs not established
Cyclohexane (110-82-7)	
ACGIH TWA (ppm)	100 ppm
OSHA PEL (TWA) (mg/m ³)	1050 mg/m ³
OSHA PEL (TWA) (ppm)	300 ppm
Isopentane (78-78-4)	
ACGIH TWA (ppm)	600 ppm (listed under Pentane, all isomers)
Remark (OSHA)	OELs not established
Pentane (109-66-0)	
ACGIH TWA (ppm)	600 ppm (listed under Pentane, all isomers)

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Pentane (109-66-0)	
OSHA PEL (TWA) (mg/m ³)	2950 mg/m ³
OSHA PEL (TWA) (ppm)	1000 ppm
Naphtha, petroleum, hydrotreated light (64742-49-0)	
Remark (ACGIH)	OELs not established
Remark (OSHA)	OELs not established
Hexane (110-54-3)	
ACGIH TWA (ppm)	50 ppm
OSHA PEL (TWA) (mg/m ³)	1800 mg/m ³
OSHA PEL (TWA) (ppm)	500 ppm
Toluene (108-88-3)	
ACGIH TWA (ppm)	20 ppm
Remark (ACGIH)	Visual impair; female repro;
Acetone (67-64-1)	
ACGIH TWA (ppm)	500 ppm
ACGIH STEL (ppm)	750 ppm
OSHA PEL (TWA) (mg/m ³)	2400 mg/m ³
OSHA PEL (TWA) (ppm)	1000 ppm
OSHA PEL (STEL) (mg/m ³)	2400 mg/m ³ (The acetone STEL does not apply to the cellulose acetate fiber industry. It is in effect for all other sectors)
OSHA PEL (STEL) (ppm)	1000 ppm
Petroleum gases, liquefied, sweetened (68476-86-8)	
Remark (ACGIH)	OELs not established
Remark (OSHA)	OELs not established
Isobutane (75-28-5)	
ACGIH STEL (ppm)	1000 ppm
Remark (OSHA)	OELs not established
Propane (74-98-6)	
ACGIH TWA (ppm)	1000 ppm (listed under Aliphatic hydrocarbon gases: Alkane C1-4)
OSHA PEL (TWA) (mg/m ³)	1800 mg/m ³
OSHA PEL (TWA) (ppm)	1000 ppm
Dimethyl ether (115-10-6)	
Remark (ACGIH)	OELs not established
Remark (OSHA)	OELs not established

8.2. Exposure controls

Appropriate engineering controls

: Provide adequate general and local exhaust ventilation. Use process enclosures, local exhaust ventilation, or other engineering controls to control airborne levels below recommended exposure limits. Use explosion-proof equipment with flammable materials. Ensure adequate ventilation, especially in confined areas.

Personal protective equipment

: Safety glasses. Gloves. Protective clothing.



Hand protection

: Use gloves chemically resistant to this material when prolonged or repeated contact could occur. Gloves should be classified under Standard EN 374 or ASTM F1296. Suggested glove materials are: Neoprene, Nitrile/butadiene rubber, Polyethylene, Ethyl vinyl alcohol laminate, PVC or vinyl.

Eye protection

: Wear eye protection, including chemical splash goggles and a face shield when possibility exists for eye contact due to spraying liquid or airborne particles.

Skin and body protection

: Wear long sleeves, and chemically impervious PPE/coveralls to minimize bodily exposure.

Respiratory protection

: Use NIOSH-approved dust/particulate respirator. Where vapor, mist, or dust exceed PELs or other applicable OELs, use NIOSH-approved respiratory protective equipment.

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Gas
Appearance	: Adhesive in pressurized canister.
Color	: No data available
Odor	: strong. Solvent.
Odor Threshold	: No data available
pH	: No data available
Relative evaporation rate (butylacetate=1)	: No data available
Melting point	: No data available
Freezing point	: No data available
Boiling point	: No data available
Flash point	: -104 °C Open Cup; Approximate - from propellant component (-156 °F)
Auto-ignition temperature	: 225 °C n-Hexane (437 °F)
Decomposition temperature	: No data available
Flammability (solid, gas)	: No data available
Vapour pressure	: No data available
Relative vapour density at 20 °C	: No data available
Relative density	: 0.67 - 0.71
Solubility	: Water: Not soluble in water
Log Pow	: No data available
Log Kow	: No data available
Viscosity, kinematic	: No data available
Viscosity, dynamic	: No data available
Explosive properties	: No data available
Oxidising properties	: No data available
Explosive limits	: 1.1 - 27 vol %

9.2. Other information

VOC content	: 489 g/l
-------------	-----------

SECTION 10: Stability and reactivity

10.1. Reactivity

No additional information available

10.2. Chemical stability

Stable under recommended handling and storage conditions (see section 7).

10.3. Possibility of hazardous reactions

None known.

10.4. Conditions to avoid

Heat, flame. Ignition sources.

10.5. Incompatible materials

Strong acids and alkalis, oxidizing agents, reducing agents, copper and copper alloys.

10.6. Hazardous decomposition products

Carbon oxides (CO, CO₂). Various hydrocarbons.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity : Oral: Not classified.

Cyclohexane (110-82-7)	
LD50 oral rat	12705 mg/kg
LD50 dermal rabbit	> 2000 mg/kg
LC50 inhalation rat (mg/l)	13.9 mg/l/4h
Isopentane (78-78-4)	
LC50 inhalation rat (mg/l)	280000 mg/m ³ 4 h

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Pentane (109-66-0)	
LD50 oral rat	> 2000 mg/kg
LD50 dermal rabbit	3000 mg/kg
LC50 inhalation rat (mg/l)	364 g/m ³ 4 h
Naphtha, petroleum, hydrotreated light (64742-49-0)	
LD50 oral rat	> 5000 mg/kg
LD50 dermal rabbit	> 3160 mg/kg
LC50 inhalation rat (ppm)	73680 ppm/4h
Hexane (110-54-3)	
LD50 dermal rabbit	3000 mg/kg
LC50 inhalation rat (ppm)	48000 ppm/4h
Toluene (108-88-3)	
LD50 oral rat	2600 mg/kg
LD50 dermal rabbit	12000 mg/kg
LC50 inhalation rat (mg/l)	12.5 mg/l/4h
Acetone (67-64-1)	
LC50 inhalation rat (mg/l)	50100 mg/m ³
Isobutane (75-28-5)	
LC50 inhalation rat (mg/l)	658 mg/l/4h
Propane (74-98-6)	
LC50 inhalation rat (mg/l)	658 mg/l/4h
Dimethyl ether (115-10-6)	
LC50 inhalation rat (mg/l)	308.5 mg/l/4h (Source: IUCLID)

Skin corrosion/irritation	: Causes skin irritation.
Serious eye damage/irritation	: Causes serious eye irritation.
Respiratory or skin sensitisation	: May cause an allergic skin reaction.
Germ cell mutagenicity	: Not classified.
Carcinogenicity	: Not classified.
Reproductive toxicity	: Suspected of damaging fertility. Suspected of damaging the unborn child.
Specific target organ toxicity (single exposure)	: May cause drowsiness or dizziness.
Specific target organ toxicity (repeated exposure)	: May cause damage to organs through prolonged or repeated exposure.
Aspiration hazard	: Not classified
Symptoms/injuries after inhalation	: May cause drowsiness or dizziness.
Symptoms/injuries after skin contact	: May cause an allergic skin reaction. Causes skin irritation.
Symptoms/injuries after eye contact	: Causes serious eye irritation.
Symptoms/injuries after ingestion	: May cause gastrointestinal irritation.
Chronic symptoms	: Suspected of damaging fertility. Suspected of damaging the unborn child. . Causes damage to organs through prolonged or repeated exposure.

SECTION 12: Ecological information

12.1. Toxicity

Ecology - general : Product may kill grasses and small plants. Not expected to be toxic to fish. Moderately toxic to amphibians. May cause gastrointestinal distress to birds and mammals through ingestion.

Hexane (110-54-3)

LC50 fishes 1	2.1 - 2.98 mg/l 96 Hr LC50 Pimephales promelas [flow-through]
---------------	---

12.2. Persistence and degradability

Wilsonart 740/741 Adhesive

Persistence and degradability	The product is not biodegradable.
-------------------------------	-----------------------------------

12.3. Bioaccumulative potential

No additional information available

12.4. Mobility in soil

No additional information available

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

12.5. Other adverse effects

No additional information available

SECTION 13: Disposal considerations

13.1. Waste treatment methods

Waste treatment methods : Do not discharge to public wastewater systems without permit of pollution control authorities. No discharge to surface waters is allowed without an NPDES permit.

Waste disposal recommendations : Dispose in a safe manner in accordance with local/national regulations. Do not allow the product to be released into the environment. Empty containers of 30 lbs or less should be returned for reconditioning and recycling according to manufacturer's instructions. Residual vapors may be explosive. Do not cut, weld, braze, or grind an empty container.

SECTION 14: Transport information

In accordance with DOT

Transport document description : UN3501 Chemical under pressure, flammable, n.o.s., 2.1
UN-No.(DOT) : 3501
DOT NA no. : UN3501
Proper Shipping Name (DOT) : Chemical under pressure, flammable, n.o.s.
Department of Transportation (DOT) Hazard Classes : 2.1 - Class 2.1 - Flammable gas 49 CFR 173.115
Hazard labels (DOT) : 2.1 - Flammable gas



DOT Quantity Limitations Passenger aircraft/rail (49 CFR 173.27) : Forbidden

DOT Quantity Limitations Cargo aircraft only (49 CFR 175.75) : 75 kg

DOT Vessel Stowage Location : D - The material must be stowed "on deck only" on a cargo vessel and on a passenger vessel carrying a number of passengers limited to not more than the larger of 25 passengers or one passenger per each 3 m of overall vessel length, but the material is prohibited on passenger vessels in which the limiting number of passengers is exceeded.

DOT Vessel Stowage Other : 40 - Stow "clear of living quarters"

Additional information

Other information : No supplementary information available.

Transport by sea

No additional information available

Air transport

No additional information available

SECTION 15: Regulatory information

15.1. US Federal regulations

Wilsonart 740/741 Adhesive	
All components of this product are listed on the TSCA Inventory or are exempt	
SARA Section 311/312 Hazard Classes	Delayed (chronic) health hazard Immediate (acute) health hazard Fire hazard
	CAS #: 108-88-3 (Toluene)
Section 302 (EHS) TPQ	lb
Section 304 EHS RQ	lb
CERCLA RQ	1000 lb
Section 313	Listed on US SARA Section 313

	CAS #: 110-82-7 (Cyclohexane)
Section 302 (EHS) TPQ	lb
Section 304 EHS RQ	lb

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

CERCLA RQ	1000 lb
Section 313	Listed on US SARA Section 313

	CAS #: 110-54-3 (n-hexane)
Section 302 (EHS) TPQ	lb
Section 304 EHS RQ	lb
CERCLA RQ	5000 lb
Section 313	Listed on US SARA Section 313

	CAS #: 67-64-1 (Acetone)
Section 302 (EHS) TPQ	lb
Section 304 EHS RQ	lb
CERCLA RQ	5000 lb
Section 313	Not Listed

15.2. International regulations

No additional information available.

15.3. US State regulations

WARNING! This product contains chemicals known to the state of California to cause cancer, birth defects, or other reproductive harm.

Benzene (71-43-2)				
U.S. - California - Proposition 65 - Carcinogens List	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
Yes	Yes	No	Yes	6.4 µg/day

Toluene (108-88-3)				
U.S. - California - Proposition 65 - Carcinogens List	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
No	Yes	No	No	7000 µg/day

Ethylbenzene (100-41-4)				
U.S. - California - Proposition 65 - Carcinogens List	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
Yes	No	No	No	54 µg/day

Cyclohexane (110-82-7)
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List

Isopentane (78-78-4)
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) List

Pentane (109-66-0)
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) List

Hexane (110-54-3)
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) List

Wilsonart 740/741 Adhesive

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Benzene (71-43-2)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) - Special Hazardous Substances
U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List

Toluene (108-88-3)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List
U.S. - Pennsylvania - RTK (Right to Know) List

Acetone (67-64-1)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) List

Isobutane (75-28-5)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) List

Propane (74-98-6)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) List


Dimethyl ether (115-10-6)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) List

SECTION 16: Other information

Indication of changes : New SDS Created.
Revision date : 10/08/2015
Other information : Author: ZPT.

NFPA health hazard : 2 - Intense or continued exposure could cause temporary incapacitation or possible residual injury unless prompt medical attention is given.
NFPA fire hazard : 4 - Will rapidly or completely vaporize at normal pressure and temperature, or is readily dispersed in air and will burn readily.
NFPA reactivity : 0 - Normally stable, even under fire exposure conditions, and are not reactive with water.

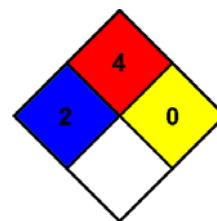

HMIS III Rating

Health : 2*
Flammability : 4
Physical : 0
Personal Protection :

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product